

C315

**1-LOAD-CELL PLATFORM SCALES
4-LOAD-CELL PLATFORM SCALES
PALLET AND BEAM SCALES**

USER MANUAL

ITKU-109-01-06-19-EN



RADWAG® RADWAG BALANCES AND SCALES
ADVANCED WEIGHING TECHNOLOGIES

JUNE 2019


CONTENTS

1. INTENDED USE	5
2. PRECAUTIONS	5
2.1. Operation.....	5
2.2. Battery Power Supply.....	5
2.2.1. Worn out Batteries Replacement.....	6
2.3. Operation in Conditions Difficult due to Electrostatics.....	6
3. MAINTENANCE ACTIVITIES	6
3.1. Cleaning ABS Components.....	7
3.2. Cleaning Stainless Steel Components.....	7
4. WARRANTY CONDITIONS	7
5. SERVICE AND REPAIR	8
6. RECYCLING	8
7. MECHANICAL DESIGN	9
7.1. 1-Load-Cell Scales.....	9
7.2. Multiple Load Cell Scales.....	9
7.3. Scales with Load-Cell Modules.....	10
7.4. Dimensions.....	11
7.5. Connectors Arrangement.....	11
7.6. Connectors Arrangement.....	11
8. UNPACKING AND INSTALLATION	11
8.1. C315.xx.K, C315.xx.R, C315.F1.M Series.....	12
8.2. C315.C2.M, C315.C3.M Series.....	12
8.3. C315.4 Series.....	13
9. START-UP AND OPERATION	13
9.1.1. Levelling: 1-Load-Cell Platform Scales.....	13
9.1.2. Levelling: 4-Load-Cell Platform Scales.....	14
9.2. Connecting the Scale to the Mains.....	14
9.3. Battery Status.....	15
9.4. Battery Charge Status Check.....	15
10. OPERATION PANEL	15
11. KEYS	16
12. PROGRAM STRUCTURE	16
12.1. Function Groups.....	16
12.2. Operating the Menu.....	17
12.3. Return to Weighing.....	17
13. WEIGHING	17
13.1. Good Weighing Practice: 1-Load-Cell Platform Scales.....	18
13.2. Good Weighing Practice: 4-Load-Cell Platform Scales.....	18
13.3. Zeroing.....	19
13.4. Taring.....	19
13.5. Entering Tare Value Manually.....	20
13.6. Dual Range Devices.....	20
13.7. Units.....	20
13.7.1. Start Unit.....	20
13.7.2. Temporary Unit.....	21
14. ADJUSTMENT	22
14.1. External Adjustment.....	22
14.2. User Adjustment.....	23
14.3. Adjustment Report.....	23
15. SCALE PARAMETERS	24
15.1. Filter.....	24
15.2. Value Release.....	24
15.3. Ambient Conditions.....	24
15.4. Autozero Function.....	25
15.5. Tare Function.....	25
15.6. Tare Entering Mode.....	26
15.7. Tare Value Memory.....	26
15.7.1. Entering Tare Value to Scale Memory.....	26
15.7.2. Selecting Tare Value from the Scale Memory.....	27
15.8. Last Digit.....	27

16. COMMUNICATION	27
16.1. RS232 (1) Port	28
16.2. RS232 (2) Port	28
16.3. Wireless Communication Module	28
17. PERIPHERAL DEVICES	29
17.1. Computer	29
17.1.1. Computer Port	29
17.1.2. Continuous Transmission	30
17.1.3. Printout Interval for Continuous Transmission	30
17.2. Printer	30
17.2.1. Port	30
17.3. Additional Display	31
17.3.1. Additional Display Port	31
18. PRINTOUTS	31
18.1. Adjustment Report	31
18.2. GLP Printout	32
19. MISCELLANEOUS PARAMETERS	33
19.1. Backlight	33
19.2. 'Beep' Sound	33
19.3. Automatic Shutdown	33
19.4. Date and Time	34
19.5. Default Operator Settings	34
20. SCALE DATA	35
21. WORKING MODES – General Information	35
21.1. Running Working Mode	35
21.2. Working Mode Local Settings	35
21.2.1. Working Mode Accessibility	36
21.2.2. Save Mode	36
21.2.3. Automatic Printout Interval	37
21.2.4. Lo Threshold	37
22. WORKING MODE – WEIGHING	38
22.1. Local Settings	38
23. WORKING MODE – PARTS COUNTING	38
23.1. Local Settings	38
23.1.1. Working Mode Selection	38
23.2. Setting Sample Mass by Entering Mass of a Single Part	39
23.3. Setting Sample Mass by Determining Mass of a Single Part	39
24. WORKING MODE - +/- CONTROL	40
24.1. Local Settings	40
24.2. Declaring Checkweighing Thresholds	40
25. WORKING MODE - PERCENT WEIGHING	41
25.1. Local Settings	41
25.1.1. Working Mode Selection	41
25.2. Reference Sample Mass Determined by Weighing	42
25.3. Reference Sample Mass Determined by Entering the Mass Value	42
26. WORKING MODE - PEAK HOLD	42
26.1. Local Settings	42
26.2. Peak Hold Operation	43
27. WORKING MODE - TOTALIZING	43
27.1. Local Settings	43
27.2. Totalizing Operation	43
28. WORKING MODE – ANIMAL WEIGHING	44
28.1. Local Settings	45
28.2. Animal Weighing Operation	45
29. DIAGRAMS OF CONNECTION CABLES	46
30. TECHNICAL SPECIFICATIONS	46
31. TROUBLESHOOTING	47
32. ERROR MESSAGES	47

1. INTENDED USE

C315 series scales enable fast and accurate mass measurement in laboratory and industry. They feature plastic housing and backlit LCD. The devices are equipped with an internal battery which allows their operation in places where there is no access to the mains. Standard C315 scales feature RS232 interface for communication with external devices (printer, computer, etc.) and offers wireless communication.

	<p><i>The C315 scale must not be operated in hazardous areas endangered with explosion of gases, and in dusty environments.</i></p>
---	--




2. PRECAUTIONS

2.1. Operation

- A. Prior the first use, carefully read this User Manual. Use the device only as intended.
- B. Scales to be decommissioned must be decommissioned in accordance with valid legal regulations.

2.2. Battery Power Supply




C315 series scales are devices intended to be supplied by **NiMH** battery (*nickel metal hydride*) of **1800- 2800 mAh** capacity.

	<p><i>Do not let battery discharge in case of prolonged storage of the device in low temperature.</i></p>
	<p><i>The equipment including accumulators does not belong to regular household waste. The European legislation requires electric and electronic equipment to be collected and disposed separately from other communal waste with the aim of being recycled. Dear user, you are obliged to dispose of the worn out battery as regulated.</i></p>
	<p><i>Notice: Symbols on batteries identify harmful compounds: Pb = lead, Cd = cadmium, Hg = mercury.</i></p>

2.2.1. Worn out Batteries Replacement


Worn out batteries of C315 scale can be replaced.

Procedure:
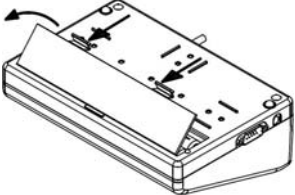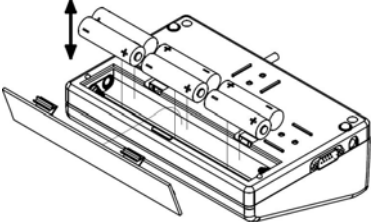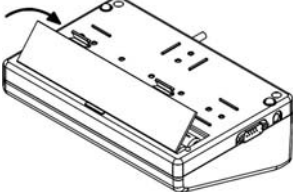
<p>Open battery container lid. The lid is to be found in the housing base.</p>	
<p>Take the worn out batteries out of the container, insert new accumulators, pay attention to +/- polarization.</p>	
<p>Close the lid.</p>	


2.3. Operation in Conditions Difficult due to Electrostatics

If the scale is to be operated in conditions that are difficult due to electrostatics (e.g. printing house, packing centre, etc.), you must connect it to the earth wire.

To enable this, the device features functional earthing terminal, marked with  symbol.

3. MAINTENANCE ACTIVITIES

In order to ensure safety in the course of cleaning, it is necessary to disconnect the device from the mains. With this condition met, uninstall the weighing pan and other detachable components.

	<p><i>Cleaning the weighing pan while still installed may cause damage of the measuring system.</i></p>
---	--

3.1. Cleaning ABS Components

To clean dry surfaces and avoid smudging, use clean non-colouring cloths made of cellulose or cotton. You can use a solution of water and detergent (soap, dishwashing detergent, glass cleaner). Gently rub the cleaned surface and let it dry. Repeat cleaning process if needed.

In the case of hard to remove contamination, e.g. residues of adhesive, rubber, resin, polyurethane foam etc., you can use a special cleaning agents based on a mixture of aliphatic hydrocarbons that do not dissolve plastics. Before using the cleanser for all surfaces we recommend carrying out tests. Do not use cleansers containing abrasive substances.

3.2. Cleaning Stainless Steel Components

Avoid using cleansers containing any corrosive chemicals, e.g. bleach (including chlorine). Do not use cleansers containing abrasive substances. Always remove the dirt using microfiber cloth to avoid damage of protective coating.

In case of a daily maintenance:


1. Remove the dirt using cloth dipped in warm water.
2. For best results, add a little bit of dishwashing detergent.

4. WARRANTY CONDITIONS

- A. RADWAG feels obliged to repair or exchange all elements that appear to be faulty by production or by construction.
- B. Defining defects of unclear origin and means of their elimination can only be realized with assistance of manufacturer and user representatives.
- C. RADWAG does not bear any responsibility for damage or losses resulting from unauthorized or inadequate performing of production or service processes.
- D. The warranty does not cover:
 - mechanical damage caused by product exploitation other than intended, damage of thermal and chemical origin, damage caused by lightning, overvoltage in the power network or other random event,
 - inappropriate cleaning habits.
- E. Loss of warranty takes place if:
 - a repair is carried out outside RADWAG authorized service point,
 - service claims intrusion into mechanical or electronic construction by unauthorized people,
 - the scale does not bear security stickers.


- F. Warranty conditions outline the warranty period for rechargeable batteries attached to the device for 12 months.
- G. For detailed warranty conditions read the warranty certificate.
- H. Contact with the central authorized service: +48 (48) 386 63 30.

5. SERVICE AND REPAIR

	<p><i>In case of any sign of damage, it is necessary to disconnect the device from the mains immediately. The damaged component must be replaced or repaired by RADWAG service immediately.</i></p>
---	--

In case of any problems with correct operation of the scale, contact the closest manufacturer's service point.

In case of defects, deliver the faulty product to the manufacturer's service point. If the product cannot be delivered to the manufacturer's service point, call the service and report the defect. Repair scope and method will be set up.

	<p><i>The user is NOT ALLOWED to carry out any kind of repair of the device himself/herself. Any attempt of scale modification, repair etc., by unauthorized persons, will result with loss of validity of manufacturer-issued certificates, declarations and warranty.</i></p>
---	--

6. RECYCLING

C315 scales must be recycled, they are not to be treated as a regular household waste. Scales to be decommissioned must be decommissioned in accordance with valid legal regulations.




7. MECHANICAL DESIGN

7.1. 1-Load-Cell Scales

1-load-cell scale C315 is intended to carry out fast and precise mass measurement of up to 300 kg loads. Its characteristic feature is a platform with one load cell only. The platform is equipped with a stainless steel weighing pan. Depending on a scale model, the cross and base are made of either stainless steel or powder-coated steel.

1-load-cell scale design, the main components:

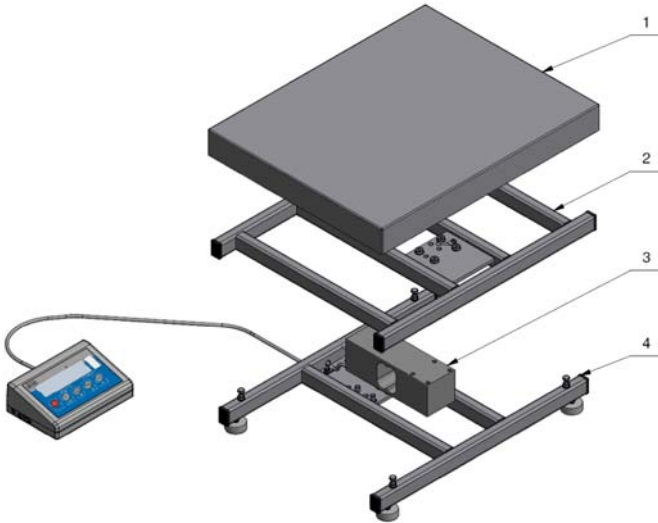


*1-load-cell scale design, the main components:
1 – weighing pan, 2 – cross, 3 - load cell, 4 - base.*

7.2. Multiple Load Cell Scales

Multiple load cell scale C315 is intended to carry out fast and precise mass measurement of large loads. Its characteristic feature is a platform equipped with numerous load cells, usually four. The platform, depending on a scale model, is made of stainless steel or powder-coated steel, it features customized mechanical design suiting particular customer's requirements (pallet, beam, platform scales).

Multiple load cell scale design, the main components:

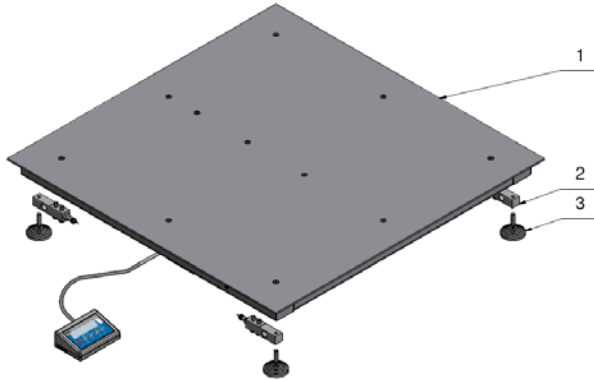


*Multiple load cell scale design, the main components:
1 - weighing pan, 2 - load cells, 3 - feet.*

7.3. Scales with Load-Cell Modules

C315 scale with load cell modules is intended to carry out mass measurement of silos. Modules are built into construction of ground-fixed silo's support. In most cases, the scale includes 3-4 load cell modules. The modules, depending on the model, are made of stainless or galvanized steel.

Scale design, the main components:


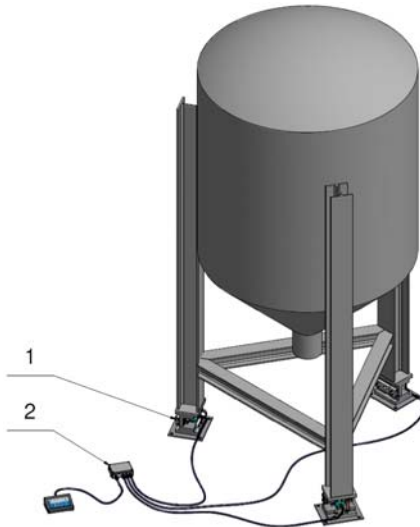


*Scale design, the main components:
1 - module, 2 - junction box.*

7.4. Dimensions



For overall dimensions, read product card of a respective scale, the product cards are to be found on RADWAG website www.radwag.com.

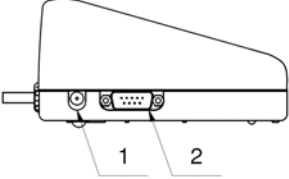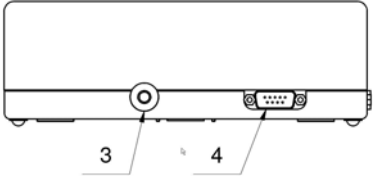7.5. Connectors Arrangement


	
<p>1 – power supply socket 2 – RS232 (1) connector</p>	<p>3 – weighing platform cable inlet 4 – RS232 (2) connector *</p>

*) – option.

7.6. Connectors Arrangement


	<p>Pin2 – RxD Pin3 – TxD Pin4 – 5VDC Pin5 – GND</p>	<p>RS232 (1) connector DB9/M (male)</p>
	<p>Pin2 – RxD Pin3 – TxD Pin4 – 5VDC Pin5 – GND</p>	<p>RS232 (2) connector DB9/M (male)</p>

8. UNPACKING AND INSTALLATION

	<p>Mind not to damage cable connecting the indicator and a weighing platform.</p>
---	--


8.1. C315.xx.K, C315.xx.R, C315.F1.M Series

- A. Take the device out of the packaging.
- B. Place the device on a flat and even surface. Keep it far away from any sources of heat.
- C. Remove transport locks and install the weighing pan:

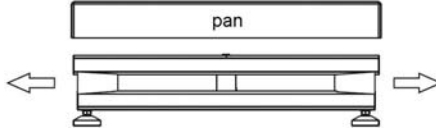


8.2. C315.C2.M, C315.C3.M Series


- A. Take the device out of the packaging.
- B. Place the device on a flat and even surface. Keep it far away from any sources of heat.
- C. Remove transport locks and install the weighing pan:

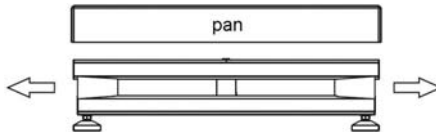

- D. Fix the post to the scale, next fix the indicator to the post:

 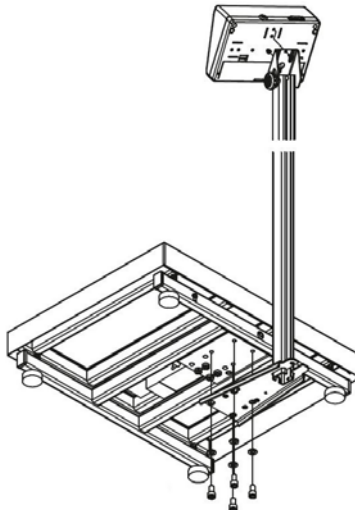


- E. Lead the cable (in excess) into the post, next fix the support foot under the post:

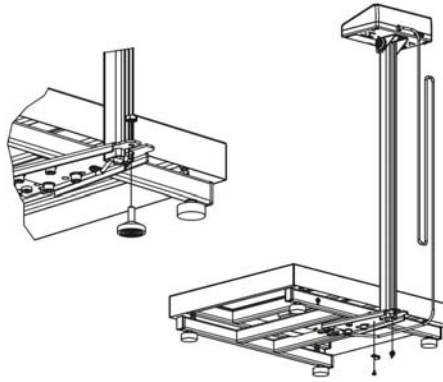


8.3. C315.4 Series

- A. Take the device out of the packaging (pallet).
- B. Place the device on a flat and even surface. Keep it far away from any sources of heat.
- C. Remove transport locks (if installed):



- D. Fix the feet (if not installed):

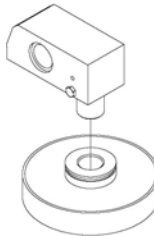

9. START-UP AND OPERATION


9.1.1. Levelling: 1-Load-Cell Platform Scales

To level the weighing instrument turn its feet. Keep turning the feet until the air bubble takes central position:



9.1.2. Levelling: 4-Load-Cell Platform Scales

To level the platform use the levelling feet and the level indicator. Each foot can be turned left and right, turning causes tilt. Adjustment span of the scale level is narrow therefore the correct level is obtained using steel washers which are to be put under the feet.

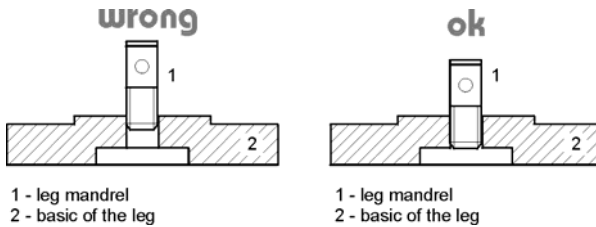



Keep turning the feet until the air bubble takes central position:




9.2. Connecting the Scale to the Mains


The weighing device can be connected to the mains only with a power supply that comes standard with the particular model. Nominal voltage of the power supply (specified on the power supply data plate) has to be compatible with the mains nominal voltage.

Procedure:



- Connect the power supply to the mains. Plug it to the power supply socket (back side of the scale housing).
- Press  key. The key is also used to switch the scale on/off.
- Display test proceeds (all symbols are backlit for a moment), program name and number is displayed first, ZERO indication with reading unit next (displayed reading unit is conditioned by scale type).
- In case the weighing result is not zero after indication stabilisation, press  button.

9.3. Battery Status


The scale of standard design is equipped with an internal battery. Battery state is signalled by  pictogram, the pictogram is displayed in the top bar of the display.

 pictogram display mode	Meaning
No pictogram	Battery charged. Regular scale operation.
Pictogram displayed continuously	Too low battery charge (the scale is about to shut down). Charge the battery immediately.
Blinking pictogram, blink frequency: ca. 1 s	Battery charge in progress. The device is connected to the power supply charging the battery.
Blinking pictogram, blink frequency: ca. 0.5 s	Battery error. Battery damaged.






9.4. Battery Charge Status Check

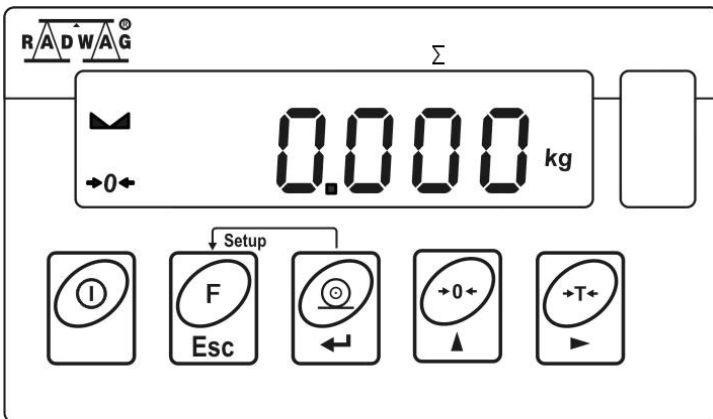


- Press  and  keys combination.
- Battery charge state, given in %, is displayed for 2s.
- Next, the home screen is displayed automatically.

10. OPERATION PANEL



11. KEYS

	Press to switch the weighing device on/off – keep the key pressed for about 1 second.
	Function key, press to change the working mode.
	Press to send the weighing result to a printer or a computer.
	Press to zero the scale.
	Press to tare the scale.

	<p>Upon pressing  +  keys combination, functions of given keys change. Detailed information concerning use of the above keys combination is to be found further down this manual.</p>
---	---

12. PROGRAM STRUCTURE

 



 







Program menu is divided into function groups. Function group is a group of interrelated parameters.

12.1. Function Groups


Function group number	Function group name	Description
P1	CAL	User adjustment
P2	rEAd	Readout parameters
P3	Func	Working modes
P4	Conn	Communication
P5	ducE	Peripheral devices
P6	Prnt	Printouts
P7	Othr	Operation-related functions
P8	InFo	Scale data
P9	Unit	Units

12.2. Operating the Menu

 
In order to navigate the menu use the operation panel.



 + 	Press to enter the main menu
 + 	Press to: <ul style="list-style-type: none"> • enter tare manually • enter tare from tare database • change value by 1 digit up • scroll the menu up
 + 	Press to check battery/accumulator state
 + 	Press to view date/time
	Press to: <ul style="list-style-type: none"> • scroll the menu down • change current parameter value
	Press to: <ul style="list-style-type: none"> • enter given submenu • modify the parameter
	Press to confirm modification
	Press to: <ul style="list-style-type: none"> • exit, function remains unmodified • move one menu level up

12.3. Return to Weighing

Introduced modifications are automatically recorded upon return to the home screen. To return to the home screen press  key repeatedly.





13. WEIGHING

Load the weighing pan. Read the result when  stability marker is displayed.

	<i>Only stable weighing results can be recorded (stability marker ).</i>
---	---

13.1. Good Weighing Practice: 1-Load-Cell Platform Scales


To assure long-term operation and correct mass measurements, follow the rules presented below:
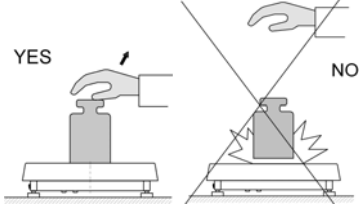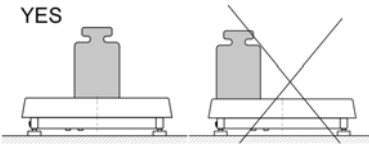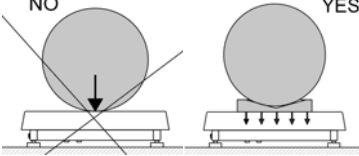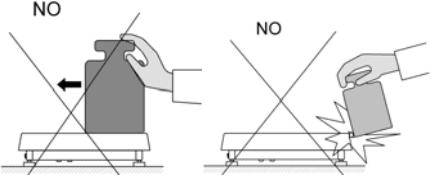
<p>Avoid applying mechanical shocks to the weighing pan.</p>	
<p>Place the loads centrally on the weighing pan (eccentricity errors are specified by PN-EN 45501 standard, point 3.6.2).</p>	
<p>Do not apply concentrated force (total load in one point).</p>	
<p>Avoid side loading, in particular side shocks.</p>	


13.2. Good Weighing Practice: 4-Load-Cell Platform Scales

It is forbidden to apply load other than intended for a particular scale:

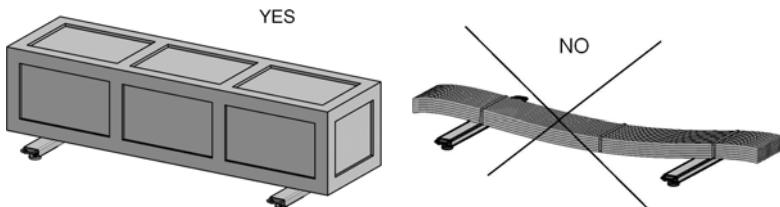

- beam scales; self-supporting, rigid load or load placed in rigid load-transferring packaging:

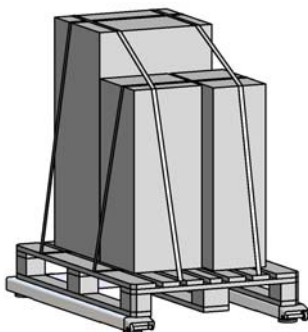


- pallet scales (load placed on EUR-pallet using pallet truck); middle block of pallet placed on the scale must remain unsupported:






13.3. Zeroing

To zero mass indication press  key. Zero indication and the following pictograms are displayed: $\rightarrow 0 \leftarrow$ and . The instrument can be zeroed only when the indication is stable.





	<p>Indication can be zeroed only within $\pm 2\%$ range of maximum capacity. If the zeroed value is above $\pm 2\%$ of the maximum capacity, then the software indicates a respective Err2 error message.</p>
---	--



13.4. Taring


To determine net weight value, load the weighing pan with a packaging, wait for a stable indication and press  key. Zero indication and the following pictograms are displayed: **Net** and . The weighing device has been tared. Upon loading, net mass is displayed. Taring can be carried out repeatedly within the whole weighing range. Remember not to exceed the maximum capacity, i.e. sum of tare weight value and load weight value must be lower than the maximum capacity value. Upon unloading the weighing pan, the sum of tared masses with minus sign is displayed.

	<p>It is impossible to tare zero or negative values. When you tare zero or negative values, message <Err3> is displayed.</p>
---	---

 
13.5. Entering Tare Value Manually

- Press  and  keys combination, tare value edit box is displayed.
- Enter tare value, to do it press  and  keys:

 


	Press to select digit that is to be edited.
	Press to set digit value, 0 - 9.

- Press  key to confirm, the scale returns to the weighing mode, modified tare value with '-' sign is displayed.
- You can enter tare value at any time during the weighing operation.

13.6. Dual Range Devices

Switching from weighing with the accuracy of the **I weighing range** to weighing with the accuracy of the **II weighing range** takes place automatically when Max of the **I weighing range** gets exceeded. Upon switching to weighing with the accuracy of the **II weighing range**,  pictogram/marker is displayed in the top left hand corner.

To return to weighing with the accuracy of the **I weighing range**:

- unload the weighing pan,
- when zero and ,  pictograms are displayed, press  key,
- II weighing range pictogram/marker gets blank.

13.7. Units


<P9.Unit> parameter group enables change of start unit and temporary unit. The unit can be changed to some other unit during weighing or during other modes operation. 'Parts counting' and 'Percent weighing' modes are exceptions.

13.7.1. Start Unit

Parameter for setting unit that is displayed and used after device start-up.

Procedure:

- Enter **<P9.Unit / 9.1.UnSt>** submenu.

- Press  key, available units are displayed successively one by one.

Options in case when the main unit is [kg]:



- kg (kilogram),
- g (gram),
- lb (pound)*,
- N (Newton).

*) – unit disabled for verified scales.

Options in case when the main unit is [g]:

- g (gram),
- kg (kilogram),
- ct (karat),
- lb (pound)*.


*) – unit disabled for verified scales.

- Select start unit and press  key, next go back to the home screen, to do it press  key.
- Upon restart the scale runs with the set start unit.

13.7.2. Temporary Unit

Temporary unit runs from the moment it is set to the scale shut-down and restart.

Procedure:

- Enter <P9.Unit / 9.2.Unin> submenu.
- Press  key, available units are displayed successively one by one.

Options in case when the main unit is [kg]:

- kg (kilogram),
- g (gram),
- lb (pound)*,
- N (Newton).

*) – unit disabled for verified scales.

Options in case when the main unit is [g]:

- g (gram),
- kg (kilogram),
- ct (karat),
- lb (pound)*.

*) – unit disabled for verified scales.

- Select temporary unit and press  key, next go back to the home screen.

14. ADJUSTMENT

Option available for non-verified scales exclusively

In order to ensure the highest weighing accuracy, it is recommended to periodically introduce corrective factor of indications to scale memory, the said factor must be referred to a reference weight. This is so called adjustment.

Adjustment has to be carried out:

- prior weighing,
- if long breaks between successive measuring series occur,
- if the ambient temperature has changed dynamically,
- if the scale has been relocated.


Adjustment types:


- external adjustment, <1.1.CA-E>, performed using an external weight of declared mass, i.e. mass that cannot be modified,
- user adjustment, <1.2.CA-u>, performed using an external weight of mass of any value comprised within the weighing range, however not lower than 30% of the maximum capacity value.

14.1. External Adjustment

External adjustment must be carried out using an external adjustment weight of class F₁.

Procedure:




- Enter <P1.CAL / 1.1.CA-E> submenu, text <UnLoAd> (remove weight) is displayed .
- Remove the load from the weighing pan and press  key.

- Mass of an empty weighing pan is determined, this is signalled with display of 'dash', < - >. Next, text <LoAd> (load weight) and mass value that is to be loaded, e.g. **2000 g** (conditioned by scale type), are displayed.
- Load the weighing pan with weight of specified mass value and press  key.
- Weight mass is determined, this is signalled with display of 'dash', < - >. Next, text <UnLoad> (remove weight) is displayed.
- Remove the load from the weighing pan, <1.1.CA-E> submenu is displayed.

14.2. User Adjustment

User adjustment must be carried out using an external adjustment weight of class F₁.

Procedure:

- Enter <P1.CAL / 1.2.CA-u> submenu, edit box for declaring weight mass is displayed (the mass value must be $\geq 30\%$ of the maximum capacity value).
- Provide weight mass value and press  key to confirm, text <UnLoAd> (remove weight) is displayed.
- Remove the load from the weighing pan and press  key.
- Mass of an empty weighing pan is determined, this is signalled with display of 'dash', < - >. Next, text <LoAd> (load weight) and mass value that is to be loaded, e.g. **1000 g**, are displayed.
- Load the weighing pan with weight of specified mass value and press  key.
- Weight mass is determined, this is signalled with display of 'dash', < - >. Next, text <UnLoad> (remove weight) is displayed.
- Remove the load from the weighing pan, <1.2.CA-u> submenu is displayed.



14.3. Adjustment Report

Adjustment report is automatically printed (using scale-connected printer) at the end of each adjustment process. To declare report content go to <P6.1.CrEP> submenu. For detailed information concerning report content read later sections of this manual.

15. SCALE PARAMETERS

Scale parameters are to be found in **<P2.rEAd>** submenu. The submenu comprises functions allowing you to adjust your weighing device to ambient conditions of given workstation (filters) or individual needs (autozero on/off, tare value memory).

15.1. Filter

- Enter **<P2.rEAd / 2.1.FiL>** submenu.
- Press  key, filter values are displayed successively one by one: **1** - Fast, **2** - Average, **3** – Slow.
- Set respective value and press  key to confirm, next go to the home screen.





The higher filter value, the longer the weighing takes.

15.2. Value Release

Enter this parameter to adjust rate of stabilisation of the measurement result. Depending on the selected option, weighing time is either shorter or longer.

Procedure:



- Enter **<P2.rEAd / 2.2.APPr>** submenu.
- Press  key, available values are displayed successively one by one: **F_P** - fast and reliable, **PrEc** – reliable, **FASt** – fast.
- Press  key to confirm, next go to the home screen.

15.3. Ambient Conditions

Parameter relating to ambient and environmental conditions of the workstation. Enter this parameter and set 'nStAb' value if the ambient conditions are unfavourable (air drafts, vibrations).

Procedure:



- Enter **<P2.rEAd / 2.3.Enut>** submenu.

- Press  key, parameter values are displayed successively one by one: **nStAb** – unstable, **StAb** – stable.
- Press  key to confirm, next go to the home screen.

15.4. Autozero Function

'Autozero' function has been designed to enable automatic control and correction of zero indication. This guarantees precise weighing results. There are, however, some cases when this function can be a disturbing factor for the measuring process. e.g. very slow loading of the weighing pan (load adding, e.g. pouring, filling). In such case, it is recommended to disable the function.


Procedure:

- Enter **<P2.rEAd / 2.4.Aut>** submenu.
- Press  key, parameter values are displayed successively one by one: **YES** – autozero function enabled, **no** – autozero function disabled.
- Press  key to confirm, next go to the home screen.


15.5. Tare Function

'Tare' function has been designed to enable setup of appropriate parameters for tare operation.

Procedure:

- Enter **<P2.rEAd / 2.5.tArE>** submenu.
- Press  key, available values are displayed successively one by one:

no	Regular tare mode. Select this parameter to make the scale overwrite the set (selected) tare value with the most recently entered one.
tArF	Select this parameter to make the scale store the latest tare value in memory. The latest tare value is displayed after scale restart.
AtAr	Auto tare mode.
EAcH	Select this parameter to make the scale automatically tare each accepted measurement.

- Press  key to confirm, next go to the home screen.

15.6. Tare Entering Mode

The tare is entered using + keys combination from the home screen level. There are two enter modes.

Procedure:

- Enter **<P2.rEAd / 2.6.ttr>** submenu.
- Press key, parameter values are displayed successively one by one:

tArEH	Select to enter tare value manually by means of + keys combination.
tArnn	Select to enter tare value that is stored in scale memory, use + keys combination.

- Press key to confirm, next go to the home screen.

15.7. Tare Value Memory


It is possible to store 10 tare values in scale memory.

15.7.1. Entering Tare Value to Scale Memory



- Enter **<P2.rEAd / 2.7.tArn>** submenu, name of tare no. 1 from tare database is displayed (**<tArE 0>**), to select a different record press button.
- Select respective entry and press key, tare value edit box is displayed.
- Enter tare value, to do it press and keys:


	Press to select digit that is to be edited.
	Press to set digit value, 0 - 9.

- Press key to confirm, **<tArE 0>** window is displayed.

- Now press  key to go to the home screen.

15.7.2. Selecting Tare Value from the Scale Memory


- Enter **<P2.rEAd / 2.7.tArN>** submenu, name of tare no. 1 from tare database is displayed (**<tArE 0>**), to select a different record press  button.
- To set the selected tare press  key.
- The set tare value is displayed with minus sign, **Net** symbol is shown in the upper-left corner of the screen:

 ***The tare value acquired from the weighing device memory is not remembered upon the weighing device restart.***


15.8. Last Digit

Function designed to disable display of the last weighing indication digit, this results with less accurate measurement.

Procedure:

- Enter **<P2.rEAd / 2.8.LdiG>** submenu.
- Press  key, available values are displayed successively one by one:

ALAS	Select to make the last digit always on.
nEur	Select to make the last digit always off.
uuSt	Select to make the last digit on only when the weighing indication is stable.

- Press  key to confirm, next go to the home screen.

16. COMMUNICATION


Communication between the PUE C315 scale and the peripheral devices is established via the following ports: RS232 (1), RS232 (2)*, wireless communication. To set the ports go to **<P4.Conn >** submenu.

*) – option.

16.1. RS232 (1) Port

- Enter **<P4.Conn / 4.1.rS1>** submenu and set respective transmission parameters:

4.1.1.bAd	Baud rate: 2400, 4800, 9600, 19200, 38400, 57600, 115200 bit/s.
4.1.2.PAr	Parity: nonE – none; EuEn – even; Odd – odd.


- Press  key to confirm, next go to the home screen.

16.2. RS232 (2) Port

Optional design

- Enter **<P4.Conn / 4.2.rS2>** submenu and set respective transmission parameters:


4.2.1.bAd	Baud rate: 2400, 4800, 9600, 19200, 38400, 57600, 115200 bit/s.
4.2.2.PAr	Parity: nonE – none; EuEn – even; Odd – odd.

- Press  key to confirm, next go to the home screen.

16.3. Wireless Communication Module




- Enter **<P4.Conn / 4.3.uuF>** submenu and set respective transmission parameters:

4.3.1.Act	Wireless communication module activation: YES – module enabled, no – module disabled.
4.3.2.StS	Network connection status: UUAIt – connecting in progress, Connec - connected, OFF – not connected.
4.3.3.tnn	Time delay. Time interval upon passage of which inactive connection with wireless communication module gets deactivated. The parameter value is declared within 0[s] - [60]s range. 0[s] is set by default (time delay inactive).

- Press  key to confirm, next go to the home screen.

In order to establish wireless communication with the scale, use „**RADWAG Connect**” PC software intended for computers and mobile devices.

„RADWAG Connect” allows connection with RADWAG devices via local network, it provides access to the basic device functions: taring, zeroing, weighing record, measurement export. The software can be installed on any mobile device: desktop computer, laptop, tablet or smartphone.

	<p><i>In order to provide correct communication with „RADWAG Connect” software via the wireless communication option you must set computer port parameter in your scale to <uuF> value.</i></p>
	<p><i>Set the transmission parameters of the wireless communication in accordance with your local network.</i></p>
	<p><i>For detailed information on establishing connection between „RADWAG Connect” software and RADWAG devices read „RADWAG Connect” software manual.</i></p>

17. PERIPHERAL DEVICES

<P5.ducE> menu contains list of devices connecting with the scale.


17.1. Computer


<5.1.PC> submenu allows you to:

- select port to which the computer is connected,
- enable/disable continuous transmission,
- set frequency of printouts for continuous transmission.

17.1.1. Computer Port


- Enter <5.1.PC / 5.1.1.Prt> submenu.

- Press  key, parameter values are displayed successively one by one: **nonE** – none; **rS1** – RS232 (1); **rS2** – RS232 (2)*; **uuF** – wireless communication.


- Press  key to confirm, next go to the home screen.

*) – option.

17.1.2. Continuous Transmission

- Enter <5.1.PC / 5.1.2.Cnt> submenu.
- Press  key, parameter values are displayed successively one by one:


nonE	Continuous transmission disabled.
CntA	Continuous transmission in basic unit.
Cntb	Continuous transmission in current/temporary unit.

- Press  key to confirm, next go to the home screen.

17.1.3. Printout Interval for Continuous Transmission

Parameter enabling you to set frequency of printout for continuous transmission. Printout interval is set in seconds with 0.1 [s] accuracy within 0.1 [s] - 3600 [s] range.

Procedure:

- Enter <5.1.PC / 5.1.3.Int> submenu, window for entering interval value is displayed.
- Press  key to confirm, next go to the home screen.

17.2. Printer



17.2.1. Port

Parameter enabling you to select port to which data is to be sent upon pressing



key.

Procedure:

- Enter <5.2.Prtr / 5.2.1.Prt> submenu.
- Press  key, parameter values are displayed successively one by one: **nonE** – none; **rS1** – RS232 (1); **rS2** – RS232 (2)*; **uuF** – wireless communication.
- Press  key to confirm, next go to the home screen.


*) – option.


17.3. Additional Display

The weighing instrument can connect with additional WD displays.

17.3.1. Additional Display Port

- Enter **<5.3.AdSP / 5.3.1.Prt>** submenu.

- Press  key, parameter values are displayed successively one by one: **nonE** – none; **rS1** – RS232 (1); **rS2** – RS232 (2)*.

- Press  key to confirm, next go to the home screen.

*) – option.

18. PRINTOUTS

It is possible to define adjustment report printout template and GLP printout template. To set the printouts go to **< P6.Prt >** submenu.

18.1. Adjustment Report

<P6.1.CrEP> is a group of parameters allowing you to declare variables that are to be printed on an adjustment report printout. Each variable features accessibility attribute: **YES** – print, **no** – do not print. Adjustment report is automatically generated at the end of each adjustment process.

Variable list:

No.	Name	Description
6.1.1.	CtP	Adjustment type.
6.1.2.	dAt	Adjustment date.
6.1.3.	tin	Adjustment time.
6.1.4.	ldb	Scale serial number.
6.1.5.	CdF	Difference between mass of an adjustment measured during the last adjustment and mass of currently measured adjustment weight.
6.1.6.	dSh	Dashed line separating printout data and signature fields.
6.1.7.	SiG	An area for the signature of an operator carrying out the adjustment.



Printouts are generated exclusively in English.

Report example:

```
-----Calibration Report-----
Calibration type           External
Date                       2016.10.15
Time                       12:39:23
Balance ID                 123456
Difference                  -0.02g
-----
Signature
.....
```

18.2. GLP Printout

<P6.2.GLP> is a group of parameters allowing you to declare variables that are to be printed on a weighing printout. Each variable features accessibility attribute: **YES** – print, **no** – do not print.

Variable list:

No.	Name	Description
6.2.1.	dAt	Weighing date.
6.2.2.	tin	Weighing time.
6.2.3.	ldb	Scale serial number.
6.2.4.	n	Net weight value of performed weighing in basic measuring unit.
6.2.5.	t	Tare weight value in a current unit.
6.2.6.	b	Gross weight value in a current unit.
6.2.7.	CrS	Current result (net weight) in a current unit.
6.2.8.	CrP	The last adjustment report generated in accordance with settings declared for the adjustment report printout.

	<i>Printouts are generated exclusively in English.</i>
---	---

Report example:

```
Date           2016.10.15
Time           12:04:17
Net            49.98g
Tare           17.20g
Gross          67.18g
```


19. MISCELLANEOUS PARAMETERS

<P7.Othr> is a group of parameters enabling you to adapt the scale to individual needs.


19.1. Backlight

Parameter allowing to change display brightness, the brightness can be changed within **0% - 100%** range.

Procedure:


- Enter <P7.Othr / 7.1.bLbt> submenu.



- Press  key, parameter values are displayed successively one by one, where:

nonE	Backlight off.
10	Display brightness low limit value in [%].
100	Display brightness high limit value in [%].



- Press  key to confirm, next go to the home screen.


19.2. 'Beep' Sound

Parameter allowing you to enable/disable sound signal informing the operator about pressing panel key(s).


Procedure:

- Enter <P7.Othr / 7.2.bEEP> submenu.



- Press  key, parameter values are displayed successively one by one: **no** – sound signal disabled, **YES** - sound signal enabled.





- Press  key to confirm, next go to the home screen.

19.3. Automatic Shutdown

Parameter allowing you to set time interval, in [min], after which the weighing device shuts down automatically. If the indication is stable during the declared time interval, the device is shut down automatically. Shutdown function is inactive and the device cannot be turned off if any process is started or if you operate the menu.

Procedure:

- Enter **<P7.Othr / 7.3.t1>** submenu.
- Press  key, parameter values are displayed successively one by one: **nonE** – function disabled, **1, 2, 3, 5, 10**.
- Press  key to confirm, next go to the home screen.

19.4. Date and Time

Parameter allowing you to set current date and time and to specify date and time format.

Procedure:

- Enter **<P7.Othr>** submenu and change the settings. Refer to the below table:

Parameter	Description
<7.4.SdAt>	Enter this parameter to set current date, where the date format is YYYY.MM.DD* .
<7.5.Stnn>	Enter this parameter to set current time, where the time format is 24H** .
<7.6.FdAt>	Enter this parameter to set date format. Values: 1 - DD.MM.YYYY, 2 - MM.DD.YYYY, 3 - YYYY.MM.DD* (set by default), 4 - YYYY.DD.MM.
<7.7.Ftin>	Enter this parameter to set time format. Values: 24H** (set by default), 12H** .


*) - Date format: Y – year, M – month, D – day.

**) - Time format: 12H – 12-hour format, 24H - 24-hour format.

19.5. Default Operator Settings

Parameter allowing you to restore default operator settings.

Procedure:

- Enter **<P7.Othr / 7.8.dFLu>** submenu, text **<Cont?>** is displayed (Continue?).
- Press  key to confirm. The process of restoring default settings starts, this is signalled with display of 'dash', **< - >**.
- Upon process completion **<7.8.dFLu>** submenu is displayed. Go to the home screen.

20. SCALE DATA

Scale data menu, <P8.InFo>, provides information on the weighing device and its program. The parameters serve informative purposes:




Parameter	Description
<8.1.Idb>	Serial number of the scale.
<8.2.PurS>	Software version.
<8.3.PStP>	Settings printout. Enter the parameter to send scale settings to printer port (all parameters).


21. WORKING MODES – General Information

The scale features the following working modes:

- Weighing,
- Parts counting,
- +/- control,
- Percent weighing %,
- Peak Hold,
- Totalizing,
- Animal weighing.

21.1. Running Working Mode

- Go to the home screen, press  key, name of the first available working mode is displayed.
- Press  key, names of available working modes are displayed successively one by one.
- Enter selected working mode, to do it press  key.

	<i>The weighing device program has been designed to make the scale run, upon restart, with the latest operated working mode on.</i>
---	--

21.2. Working Mode Local Settings


Each working mode features specific functions which enable adapting device operation to individual needs. To go to local settings of each working mode enter <P3.Func> submenu.

Some special functions are available for all working modes, refer to the table below:



	Accessibility	Save mode	Time interval	Lo threshold
Weighing	3.1.1.Acc	3.1.2.Snn	3.1.3.Int	3.1.4.Lo
Parts counting	3.2.1.Acc	3.2.3.Snn	3.2.4.Int	3.2.5.Lo
+/- control	3.3.1.Acc	3.3.2.Snn	3.3.3.Int	3.3.4.Lo
Percent weighing %	3.4.1.Acc	3.4.3.Snn	3.4.4.Int	3.4.5.Lo
Peak Hold	3.5.1.Acc	-	-	3.5.2.Lo
Totalizing	3.6.1.Acc	3.6.2.Snn	3.6.3.Int	3.6.4.Lo
Animal weighing	3.7.1.Acc	-	-	3.7.3.Lo

The table presents special function number and name for each of the working modes. Remaining specific functions referring directly to a given working mode are described further down this user manual.

21.2.1. Working Mode Accessibility

To enable/disable a given working mode, press  key.


Procedure:


- Enter **<P3.Func>** menu and select a given working mode.
- Go to **<Acc>** function.
- Press  key, parameter values are displayed successively one by one: **YES** – working mode enabled, **no** – working mode disabled.
- Press  key to confirm, next go to the home screen.


21.2.2. Save Mode

Parameter allowing you to set mode of sending data from the weighing device to a peripheral device.

Procedure:

- Enter **<P3.Func>** menu and select given working mode.
- Go to **<Snn>** function.
- Press  key, parameter values are displayed successively one by one:


StAb	Manual printout of stable weighing result. Upon pressing  key at the moment when the result is unstable (no ▲▶ pictogram displayed), the program first waits for the stability condition to be met, only then the printout is carried out.
nStAb	Manual printout of each weighing result. In case of unstable indication, <?> sign is displayed in front of the 'mass frame'. Function available for non-verified scales exclusively.
rEPL	Automatic printout of the first stable weighing result above <Lo> threshold (to set <Lo> threshold go to <Lo> parameter).
rEPLi	Automatic printout with time interval set in [min] (to set the interval go to <Int> parameter).

- Press  key to confirm, next go to the home screen.

21.2.3. Automatic Printout Interval

Parameter enabling you to set frequency of an automatic printout. Printout interval is set in minutes with 1 [min] accuracy within 1 [min] 1440 [min] range.


Procedure:

- Enter <P3.Func> menu and select given working mode.
- Enter <Int> function, window for entering **time interval** value is displayed.
- Press  key to confirm, next go to the home screen.

21.2.4. Lo Threshold

<Lo> parameter allows you to configure the function of automatic operation. In order to save the next measurement, before carrying it out, the mass indication must get below the set net value of **Lo threshold**.

Procedure:

- Enter <P3.Func> menu and select given working mode.
- Enter <Lo> function, window for entering **Lo threshold** value is displayed.
- Enter respective value and press  key to confirm, then continue weighing.

22. WORKING MODE – WEIGHING

<UUGG> is a standard working mode enabling you to carry out the weighing operation along with record of the result to the database.

22.1. Local Settings

To go to local settings enter <3.1.UUGG> submenu.

3.1.1.Acc	Working mode accessibility	For detailed description read section 19.2.1.
3.1.2.Snn	Save mode	For detailed description read section 19.2.2.
3.1.3.Int	Time interval	For detailed description read section 19.2.3.
3.1.4.Lo	Lo threshold	For detailed description read section 19.2.4.

23. WORKING MODE – PARTS COUNTING

Parts Counting is a working mode enabling you to determine quantity of small pieces of the same mass, which determination is done on the basis of mass of sample piece (single part), and where the sample piece mass (single part mass) is determined using the weighing device.

23.1. Local Settings

To go to local settings enter <3.2.PcS> submenu.

3.2.1.Acc	Working mode accessibility	For detailed description read section 19.2.1.
3.2.2.UUt	Operation mode	For detailed description read section 21.1.1.
3.2.3.Snn	Save mode	For detailed description read section 19.2.2.
3.2.4.Int	Time interval	For detailed description read section 19.2.3.
3.2.5.Lo	Lo threshold	For detailed description read section 19.2.4.

23.1.1. Working Mode Selection

Parameter allowing you to select method of determination of sample piece mass.

Procedure:

- Enter <3.2.PcS / 3.2.2.UUt> submenu.





- Press the key, parameter values are displayed successively one by one:

S_S	Select to set sample mass by determining mass of a single part.
Suu	Select to set sample mass by entering mass of a single part.


- Enter respective value and press  key to confirm, then continue weighing.

23.2. Setting Sample Mass by Entering Mass of a Single Part




- Enter <3.2.PcS / 3.2.2.UUt> submenu, set <Suu> value.
- Enter <PcS> working mode (parts counting), first, text <SEt_Ut> is displayed for 1 s, next, window for entering mass value of a single part.
- Enter respective value and press  key to confirm, home screen is displayed automatically along with quantity of parts loaded onto the weighing pan (pcs).

	<i>If the value of entered single part mass is greater than max capacity value, message <Err Hi> is displayed.</i>
---	--





23.3. Setting Sample Mass by Determining Mass of a Single Part

- Enter <3.2.PcS / 3.2.2.UUt> submenu, set <S_S> value.
- Enter <PcS> working mode (parts counting), blinking value of sample quantity is displayed.
- Press  key to select one of the following options:

10	Reference sample quantity: 10 pcs.
20	Reference sample quantity: 20 pcs.
50	Reference sample quantity: 50 pcs.
100	Reference sample quantity: 100 pcs.
0000	Custom reference sample quantity - enter the required value yourself.

- Select respective option and press  key to confirm, first, text <LoAd> is displayed for 1 second, then the weighing window.
- If the parts are to be weighed in a container, first put the container on a weighing pan and tare it.
- Load the weighing pan with declared amount of parts. When the indication is stable ( pictogram is displayed), press  key to confirm the mass.

- Single part mass is calculated automatically, next quantity of parts (pcs) is displayed.

	Total weight value of all parts loaded onto the weighing pan cannot be greater than the max capacity value.
	Single part mass value must be equal to or greater than 0.1 of the reading unit. Unless this condition is met, the weighing device displays a message <Err Lo>.
	In the course of parts quantity determination before confirming the declared quantity value it is necessary to wait for a stable measurement .

24. WORKING MODE - +/- CONTROL




+/- control is a working mode enabling you to enter checkweighing threshold values (**Min**, **Max**).

24.1. Local Settings



To go to local settings enter <**3.3.HiLo**> submenu.

3.3.1.Acc	Working mode accessibility	For detailed description read section 19.2.1.
3.3.2.Snn	Save mode	For detailed description read section 19.2.2.
3.3.3.Int	Time interval	For detailed description read section 19.2.3.
3.3.4.Lo	Lo threshold	For detailed description read section 19.2.4.

24.2. Declaring Checkweighing Thresholds

- Enter <**HiLo**> working mode (+/- control), first, text <**SEt Lo**> is displayed for 1 s, next, window for declaring low weighing threshold (Min).

- Enter respective value and press  key to confirm, first, text <**SEt Hi**> is displayed for 1 second, next, window for declaring high weighing threshold (Max).
- Enter respective value and press  key for confirmation, working mode's home screen is displayed along with declared threshold value, where:

Min	Load mass lower than low weighing threshold.
Ok	Load mass within weighing thresholds.
Max	Load mass greater than high weighing threshold.

	<i>If the entered low threshold value (Min) is greater than the high threshold value (Max), <Err Lo> error is displayed.</i>
	<i>If the entered high threshold value (Max) is greater than the maximum capacity value, <Err Hi> error is displayed.</i>

25. WORKING MODE - PERCENT WEIGHING

Percent weighing is a working mode enabling you to compare measured load mass with the reference sample mass. The result is expressed in [%]. Reference sample mass can be either determined by weighing or entered to the weighing device memory by an operator.

25.1. Local Settings


To go to local settings enter <3.4.dEu> submenu.

3.4.1.Acc	Working mode accessibility	For detailed description read section 19.2.1.
3.4.2.UUt	Operation mode	For detailed description read section 23.1.1.
3.4.3.Snn	Save mode	For detailed description read section 19.2.2.
3.4.4.Int	Time interval	For detailed description read section 19.2.3.
3.4.5.Lo	Lo threshold	For detailed description read section 19.2.4.

25.1.1. Working Mode Selection

Parameter allowing you to select method of determination of reference sample mass.



Procedure:

- Enter <3.4.dEu / 3.4.2.UUt> submenu.
- Press  key, parameter values are displayed successively one by one:


S_S	Select to set reference sample mass by determining the mass value.
Suu	Select to set reference sample mass by entering the mass value.


- Set respective value and press  key to confirm, next go to the home screen.

25.2. Reference Sample Mass Determined by Weighing

- Enter **<3.4.dEu / 3.4.2.UUt>** submenu, set **<S_S>** value.
- Enter **<dEu>** working mode (Percent weighing), first, text **<LoAd>** is displayed for 1 second, then the weighing result window.
- Load the weighing pan with the reference sample. When the indication is stable ( pictogram is displayed), press  key to confirm the mass.
- Mass of the weighed load is automatically set as reference sample mass, the home screen is displayed along with **100.000%** value.

25.3. Reference Sample Mass Determined by Entering the Mass Value

- Enter **<3.4.dEu / 3.4.2.UUt>** submenu, set **<Suu>** value.
- Enter **<dEu>** working mode (Percent weighing).
- Text **<SEt Ut>** is displayed for 1 s, next, window for declaring mass value of the reference sample.
- Enter respective value and press  key to confirm. The home screen is displayed automatically with **0.000%** value.

	<i>If the value of entered reference sample mass is greater than max capacity value, message <Err Hi> is displayed.</i>
---	--

26. WORKING MODE - PEAK HOLD


Peak Hold is a working mode allowing you to snap value of maximum force applied to the weighing pan during one weighing process.

26.1. Local Settings

To go to local settings enter **<3.5.toP>** submenu.

3.5.1.Acc	Working mode accessibility	For detailed description read section 19.2.1.
3.5.2.Lo	Lo threshold	For detailed description read section 19.2.4.

26.2. Peak Hold Operation

- Enter **<3.5.toP / 3.5.2.Lo>** submenu, set **<Lo>** parameter value (Lo threshold) after exceeding of which maximum force is to be registered.
- Enter **<toP>** working mode (Peak Hold). From now on the scale registers and holds every single weighing which is above the **Lo threshold**, and which is higher than the result of the previous peak hold. Snapped peak hold value is signalled by **<Max>** pictogram displayed at the top of the screen.
- The start of the next process of peak hold measurement is possible only after removing the load from the weighing pan and pressing  button.
- This causes returning to the home screen of **<toP>** mode. Pictogram **<Max>** is automatically deleted.

27. WORKING MODE - TOTALIZING



Totalizing is a working mode enabling you to sum mass of all weighed ingredients, and to print (via scale-connected printer) the total mass value. The program allows you to sum up to 30 weighings (ingredients) maximum within one process.




27.1. Local Settings

To go to local settings enter **<3.6.Add>** submenu.

3.6.1.Acc	Working mode accessibility	For detailed description read section 19.2.1.
3.6.2.Snn	Save mode	For detailed description read section 19.2.2.
3.6.3.Int	Time interval	For detailed description read section 19.2.3.
3.6.4.Lo	Lo threshold	For detailed description read section 19.2.4.

27.2. Totalizing Operation



- Enter **<Add>** working mode (Totalizing), blinking „▲” pictogram is displayed.
- If the ingredients are to be weighed in a container, first put the container on a weighing pan and tare it.
- Load the weighing pan with the ingredient no.1. When the indication is stable ( pictogram is displayed), press  key to confirm the mass.
- Total mass value is displayed, now the „▲” pictogram is displayed continuously.


- Unload the weighing pan, **ZERO** is displayed, „▲” marker starts blinking again.
- Load the weighing pan with the ingredient no.2, wait for a stable weighing result and press  key.
- Total mass value of ingredient no. 1 and 2 is displayed, now the „▲” pictogram is displayed continuously.
- In order to finish the process, press  key, text <Prnt?> (Print?) is displayed.
- Press  key, total mass value of all recorded weighings is printed on a scale-connected printer.

Report example:

(1)	13.500 g
(2)	14.400 g
(3)	9.700 g
(4)	100.500 g
(5)	4.000 g
(6)	8.200 g
(7)	20.800 g
(8)	5.800 g

Total:	176.900 g

- In order to print the report once again press  key.
- To exit "report printout mode" press  key. As a result home screen of <Add> working mode is displayed and all the data get zeroed automatically.

	<p><i>If the display capacity is exceeded (i.e. there is not enough space for all the digits of the weighing result), <Hi> error is displayed. In such a case either remove the ingredient from a weighing pan and finish the totalizing process or place load of a lower weight value on the weighing pan.</i></p>
---	--

28. WORKING MODE – ANIMAL WEIGHING





Animal Weighing is a working mode enabling you to weigh products that disrupt efficient establishing of stability. It is mostly intended to measure weight of animals.

28.1. Local Settings


To go to local settings enter **<3.7.AnLS>** submenu.

3.7.1.Acc	Working mode accessibility	For detailed description read section 19.2.1.
3.7.2.Aut	Averaging time	Enter this parameter to declare duration of the process in seconds (5s, 10s, 20s, 30s, 40s, 50s, 60s) - on the basis of indications recorded within the set time interval the scale calculates the weighing result, i.e. an average weight value.
3.7.3.Lo	Lo threshold	For detailed description read section 19.2.4.


28.2. Animal Weighing Operation

- Enter **<AnLS>** working mode (Animal Weighing).
- First text **<tinnE>** is displayed for **1 s**, next, window for setting duration (in seconds) of animal weighing.
- Press  key, parameter values are displayed successively one by one: 5[s], 10[s], 20[s], 30[s], 40[s], 50[s], 60[s].
- Set the respective value, press  key to confirm, weighing result window with **A** letter is displayed.
- Load the weighing pan with an animal.
- On exceeding the set mass value of **<Lo> threshold** parameter, animal weighing starts, this is signalled with display of 'dash', **< - >**.
- Upon process completion, mass value of an animal is snapped and displayed together with **OK** pictogram in the upper part of the display. The snapped mass value is sent to a scale-connected printer.
- Press  key to restart animal weighing.
- Press  key to reprint the snapped mass value.
- Upon unloading of the weighing platform, the weighing result window with letter **A** is displayed. The scale can be loaded with an animal again.

29. DIAGRAMS OF CONNECTION CABLES

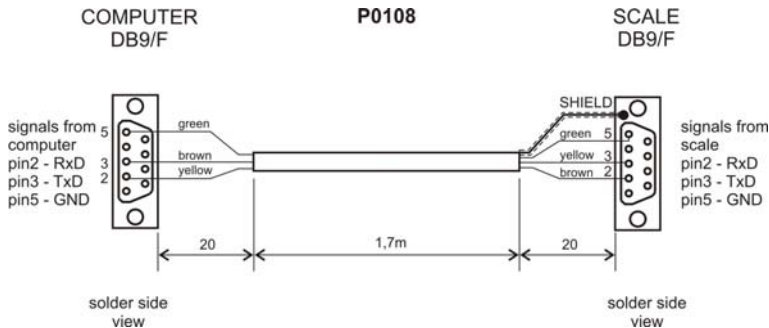

Scale - computer cable

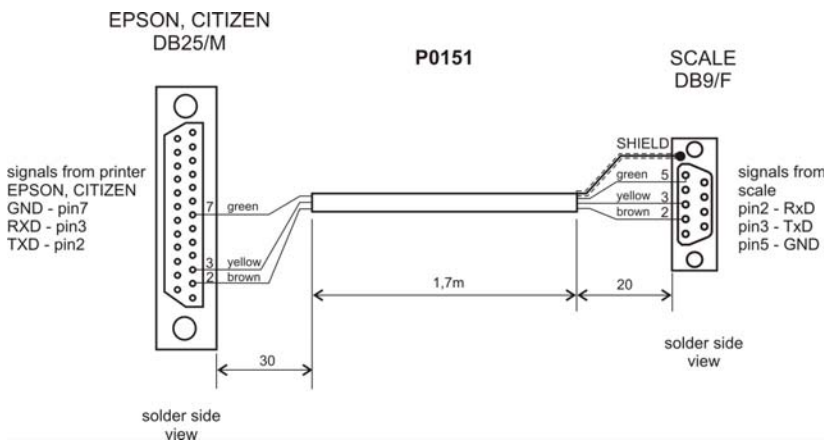

Scale - printer cable (EPSON)

30. TECHNICAL SPECIFICATIONS

For technical specifications of respective scales go to RADWAG website www.radwag.pl.

31. TROUBLESHOOTING

Problem	Cause	Solution
The scale does not switch on.	Battery discharged.	Connect the scale to the mains, charge the battery (batteries).
	No batteries (batteries not installed or installed incorrectly).	Check if batteries are installed correctly (polarization).
The scale switches off automatically.	<7.3.t1> parameter set to value enforcing scale shut-down after particular time interval.	Go to 'Othr' menu, set <7.3.t1> parameter to 'nonE' value.
During switching on, message 'LH' is displayed.	Weighing pan loaded during switching-on process.	Unload the weighing pan. Zero indication is displayed.

32. ERROR MESSAGES

- Err 2 -	- Value beyond zero range.
- Err 3 -	- Value beyond tare range.
- Err 4 -	- Adjustment weight or start mass out of range ($\pm 1\%$ for adjustment weight, ± 10 for start mass).
- Err Lo -	- Determined mass of single part in 'Parts counting' mode too small. - Entered value of 'Min' threshold greater than value of 'Max' threshold in '+/- control' mode.
- Err Hi -	- Entered value of single part greater than maximum capacity in 'Parts counting' working mode. - Entered value of 'Max' threshold greater than maximum capacity in '+/- control' mode. - Entered reference mass greater than maximum capacity in 'Percent weighing' mode.
- Err 8 -	- Time of the following operations exceeded: taring, zeroing, start mass determining, adjustment.
- null -	- Zero value from converter.
- FULL -	- Weighing range exceeded.
- LH -	- Start mass error, indication out of range (-5% – +15% of start mass).
- Hi -	- Display range of total mass on scale display exceeded in 'Totalizing' mode.



RADWAG BALANCES AND SCALES
ADVANCED WEIGHING TECHNOLOGIES

